

## **Project Report**



11-06-19\_Call\_Out 94-97 Grange Road South West London SW60 2PA

Urang	Project Information	94-97 Grange Road , South West London , SW60 2PA
Engineer:	Date:	Reference:
Dean	11/06/19	20190611-3216


Project Information				
Filename	11-06-19_Call_Out			
Site Name/Number	94-97 Grange Road			
Site Address	South West London			
Postcode	SW60 2PA			
Parking Restrictions	None			
Client	Mrs Parsons			
Reference	20190611-3216			
Drawing Number	0001			
Reason	Blockage			
Engineer	Dean			
Export Date	11/06/19			
Export Time	15:45			

## **Engineer's Notes**

there are multiple cracks in the one section, this part of the pipe will need to be replaced and a new section is required.


there is one major offset joint this needs addressing (grade 3) there has been previous work done on this section (patch liner) we recommend that the entire section is replaced and including the IC lid. overall grade is a (4)

Urang Igroup	Project Drawing	94-97 Grange Road , South West London , SW60 2PA
Engineer:	Date:	Reference:
Dean	11/06/19	20190611-3216

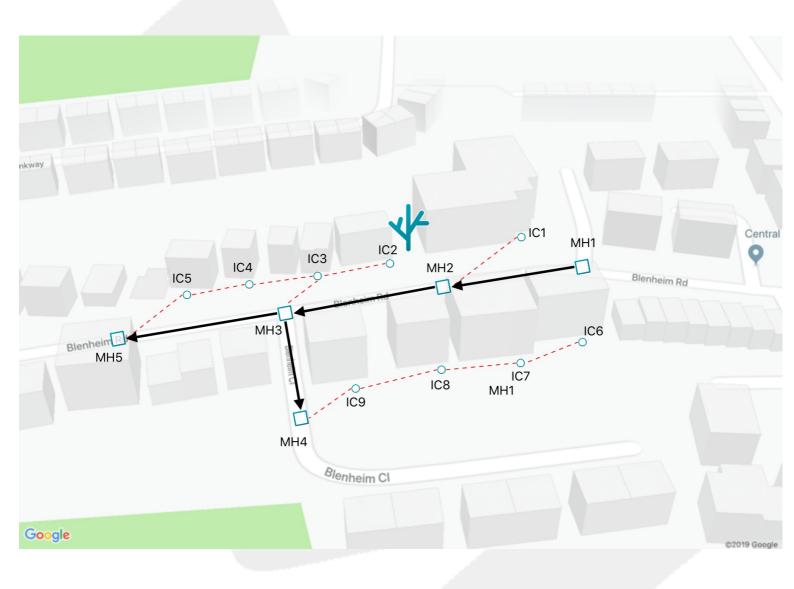




(U)rangi grace		Section Information		94-97 Grange Road , South West London , SW60 2PA	
Engineer: Dean		Date: 11/06/19		Reference 20190611	
Section Video: ic1_mh1\video.mp4	Start: IC1		Direction: Downstream		End: MH1
Material: UPVC	Pipeline :	Size:	Duty: Surface		Invert Depth: 0.3
Date: 2019-06-11	Time: 15:21		Comments: None		

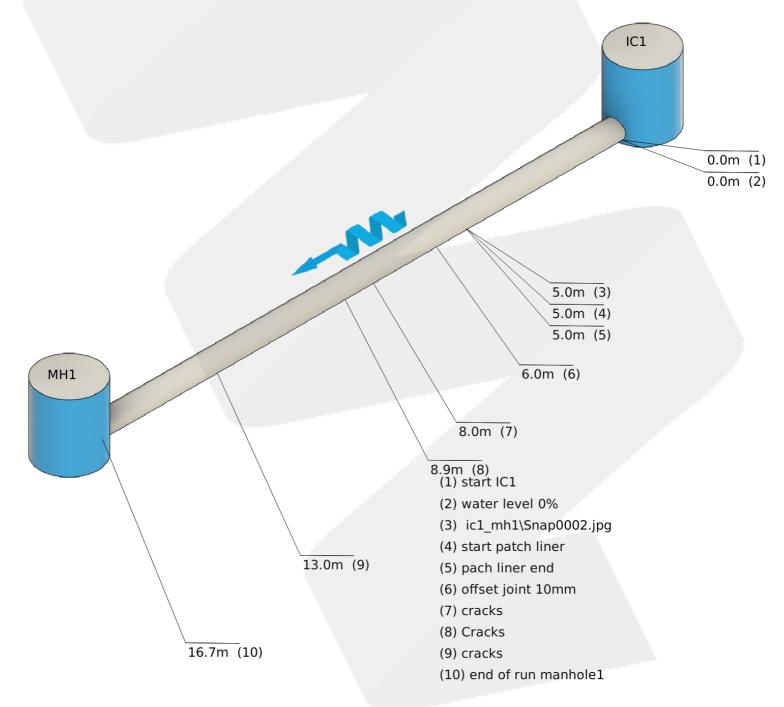





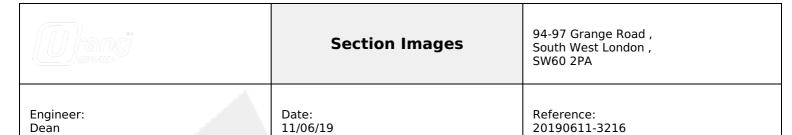



Observation [1]: start IC1



Observation [2]: water level 0%



Observation [4]: start patch liner



Observation [5]: pach liner end

App Store



## **Section Images**

94-97 Grange Road , South West London , SW60 2PA

Engineer: Dean


Date: 11/06/19 Reference: 20190611-3216



Observation [6]: offset joint 10mm



Observation [7]: cracks

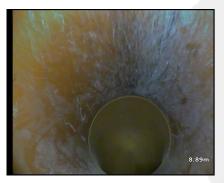

Observation [8]: Cracks



Observation [9]: cracks





Observation [10]: end of run manhole1

Download on the App Store